




# **OPERATING PROCEDURE**

A nonwetting liquid like mercury does not spontaneously fill pores of a sample because the sample/ nonwetting liquid surface free energy is greater than the sample/gas surface free energy. However, application of pressure can force a nonwetting liquid into the pores of a sample. The differential pressure required to force the nonwetting liquid into a pore is given by:

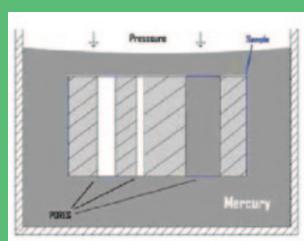

# $p = 4 \gamma \cos \theta / D$

Where:

D = pore diameter

y = surface tension of liquid

 $\theta$  = contact angle of liquid with the sample


p = differential gas pressure

The pore diameter at any location in a pore is defined such that (dS/dV) = (4/D), where (dS/dV) is the ratio of small increase in surface area due to a small increase in volume of nonwetting liquid in the pore. In this technique the pressure and the volume of intruded nonwetting liquid are accurately measured. Combining these data with the surface tension and the contact angle of the liquid, pore diameter, pore volume, pore volume distribution and pore surface area are computed.

- Pore volume versus diameter
- Delta volume (histogram)
- Pore distribution (histogram)
- Percent total pore volume
- Pore distribution (pressure and diameter)
- Particle size distribution (histogram)
- Percent porosity and density
- DATA PEROPT • Cumulative surface area
  - - Porosimetry text data
      - Summary sheet (reporting median pore sizes based on volume and surface area along withbstandard deviations)
        - Auto merging of low and high pressure data in a single graph over the entire analysis range.

# **SOFTWARE FEATURES**

- Windows 7 Pro compatible software enables convenient use of the instrument.
- User defined contact angle and surface tension can be entered.
- Data can be collected either at user-specified pressure values, at user-specified intrusion volume values, or at evenly spaced user-specified number of data points.
- Equilibrium conditions are also user adjustable.
- Multiple users and/or sample types can be given their own software "group". The software settings are remembered independently for each "group".
- Outgassing and pretreatment performed either automatically or manually. The user can skip the normal automatic outgassing procedure.
- Testing can be paused at any time. While a test is paused, the software allows full manual operation of the instrument while retaining the ability to continue the test when manual control is completed.
- Separate software for report generation enables the user to plot up to seven test results on the same graph. Report generation does not have to be performed on the same computer that controls the instrument.
- The report software allows data to be converted directly into an Excel spreadsheet or exported to standard text or tab-delimited database or other programs.
- The software features curve fitting and interpolation routines that help in better analysis of the data.
- Desired pressure units can be selected for the reports independent of the units in test.
- Diagnostic menu, easy to identify problems
- Report software enables user to view reports, modify scales in graphs and print reports.

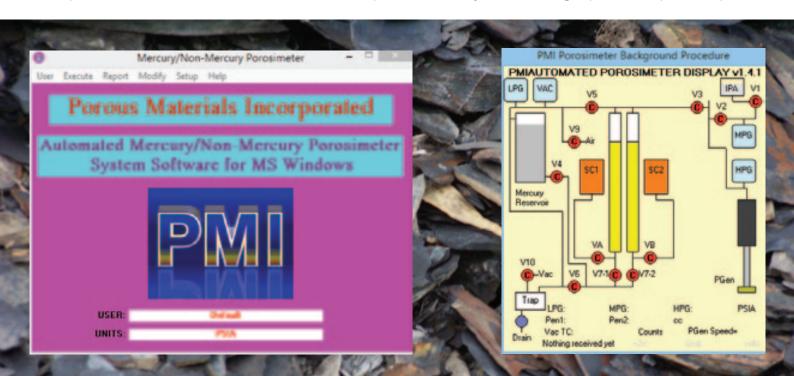

## UNIQUE FEATURES

- Mercury and Water (other non-wetting liquid) Porosimetry can be performed in the Porosimeter.
- Large sample chamber can be used to test a representative sample
- A unique system design allows use of the sample chamber to be connected to or isolated from the low pressure and high pressure sections of the instrument. This allows fully automated testing with no requirement to transfer samples from a low pressure station to a high pressure station in the middle of the test.
- Equipment design allows extrusion to be performed even at sub atmospheric pressures.
- Operator involvement is minimum.
- Automatic clean-out routines after test limit the amount of mercury exposure.
- Samples can be tested at elevated or sub-ambient temperatures.
- Sample chamber and penetrometer are made out of stainless steel.
- Novel design enables sample chamber and penetrometer tube to be changed individually and independently.
- In-situ pretreatment of samples is preformed to avoid contamination.
- Ability to test Rock core, concrete, carbonate, mortar, and cement paste.

# **Pore Structure Characteristics:**

- Mean Pore Size
- Pore Size Distribution
- Total Pore Volume
- Porosimetry Surface Area
- Bulk Density
- Absolute Density
- Particle Size Distribution

#### **APPLICATIONS**

Rock core industry

Catalyst Industry

Cement Industries

Automotive Industry

Battery/Fuel Cells Industry

Ceramic Industry

Chemical Industry

Filtration Industry

Paper Industry

Pharmaceutical/Medical Industry

Powder Metallurgy Industry

And many more...

# **SPECIFICATIONS**

- Pore Size Range: 0.003 500 microns, 0.006 500 microns or wider
- Pressure increment mode: Step and continuous
- *Accuracy:* 0.001cc
- Pressure Range: 60,000 psi/ 30, 000 psi
- Pressure Transducer Range: 0 60,000 psi, 0-30,000 psi
- Pressure Transducer Accuracy: ±0.15%
- Transducer Hysteresis: ±0.10%
- Resolution: 1 in 60,000
- Power Requirements: 220-230 VAC, 50 Hz (Others available)
- Dimensions: 72" H x 30" W x 30" D
- Weight: 200Kg
- Sample Cell (Stainless Steel) Volume: Upto 20 ml (Min) with sample dimensions upto 25mm diameter (min) x 50mm length (min)
- Sample Cell to accommodate about 10cc bulk volume.
- Sample Chamber: one chamber upto 20 ml and one chamber upto 50 ml. (No need to transfer the sample chamber during the test).
- Sample Chamber Sizes:
- o Sample Chamber 1: 1" diameter & 1" Tall sample chambers tested up to 60,000PSI
- o Sample Chamber 2: 2" diameter & 4" Tall sample chambers tested up to 30,000PSI
- o For measuring concrete and other non-homogeneous materials.

## **FEATURES**

- Non Mercury Porosimetry can be done with no extra charges.
- Test Substance (Mercury as well as non mercury)
- Automated Control
- · Ability to test concrete, sandstone, carbonate, mortar, and cement paste
- Windows-based software handles all control, measurement, particle size distribution (Powders), d
  collection, and report generation; manual control also possible
- Unlimited user-defined data points based on pressure, volume, or a combination
- Displays both intrusion and extrusion curve
- Real-time graphical test display shows testing status and results throughout operation
- Automatic mercury refill including cold trap to prevent release of mercury vapor to labo environment and clean up, mercury recovery kit included
- Core I5, at least 8GB ram and 1000GB hard drive, 1GB Graphics Card, led 21" display, DVD drive, ports, RS232 interface, compatible with Windows 7 or higher



# The most advanced, accurate, easy to use and reproducible Porosimeters in the world

# Celebrating



of solutions



20 Dutch Mill Rd, Ithaca, NY 14850, USA Toll Free (US & Canada): 1-800-TALK-PMI (1-800-825-5764) Phone: 607-257-5544 Fax: 607-257-5639

Email: info@pmiapp.com

